Cylindrical photoelectric sensor in M18 stainless steel housing

# E3F2-SUS

The stainless steel housing provides enhanced detergent resistance and longer lifetime in demanding environments.

- · Complete sensor portfolio in robust stainless steel housing
- IP67, IP69K for highest water resistance
- Enhanced detergent resistance (ECOLAB certified)
- · High power LED to compensate for dirt and misalignment



# **Selection Guide**

Sensing method	Sensing distance	Connection method				Order code	
		<u>°</u>	<b>000</b>	Ш		PNP output	NPN output
Through-beam	7 m	-	-	2 m	_*1	E3F2-7B4-S 2M	E3F2-7C4-S 2M
		-		Ι	_*1	E3F2-7B4-M1-S	E3F2-7C4-M1-S
Retro-reflective with M.S.R. <sup>*2</sup>	0.1 to 4 m (adjustable) <sup>*3</sup>	-	-	2 m	_*1	E3F2-R4B4-S-E 2M	E3F2-R4C4-S-E 2M
	(adjustable)	_		-	_*1	E3F2-R4B4-M1-S-E	E3F2-R4C4-M1-S-E
Diffuse-reflective	0.1 m (fixed, wide beam)	-	_	2 m	_*1	E3F2-DS10B4-S 2M	E3F2-DS10C4-S 2M
╓═Ҵ╫҈)┿		_		-	_*1	E3F2-DS10B4-M1-S	E3F2-DS10C4-M1-S
	0.3 m (adjustable)	-	-	2 m	_*1	E3F2-DS30B4-S 2M	E3F2-DS30C4-S 2M
		-		I	_*1	E3F2-DS30B4-M1-S	E3F2-DS30C4-M1-S
Diffuse-reflective (background suppression)	0.1 m (fixed)	-	_	2 m	_*1	E3F2-LS10B4-S 2M	E3F2-LS10C4-S 2M
		-		-	_*1	E3F2-LS10B4-M1-S	E3F2-LS10C4-M1-S

\*1. Pre-wired connectors are available on request. Contact your OMRON representative. \*2.

Order reflector separately \*3.

Measured with E39-R1S

Note: Standard cable length is 2 m. Models provided with a 5 m long cable are available. When ordering, specify the cable length by adapting the length of the cable (e.g. E3F2-R4B4-S-E 5M). For other cable length please contact your OMRON sales representative.

# Accessories (Order separately)

Name	Sensing distance (typical)*1	Model	Remark
Reflectors	4 m [100 mm]	E39-R1S	60 x 40 mm
	3 m [100 mm]	E39-R48	60 x 40 mm, enhanced chemical resistance
	5 m [100 mm]	E39-R7	Ø 84 mm
	6 m [100 mm]	E39-R8	100 x 100 mm
	5 m [100 mm]	E39-R40	80 x 80 mm
Tape Reflectors	0.7 m [150 mm]	E39-RS1	35 x 10 mm
	1.1 m [150 mm]	E39-RS2	35 x 40 mm
	1.4 m [150 mm]	E39-RS3	80 x 70 mm
Lens Cap		E39-F31	
Mounting Bracket		Y92E-B18	screw mount

\*1. Values in parentheses indicate the minimum required distance between the sensor and reflector.

Note: For detailed information about Accessories, refer to the main chapter "Accessories" at the end of the document.

# Sensor I/O Connectors

Cord	Shape	Cable type		Model
Standard	Straight	2 m	M10 connector	XS2F-D421-D80-A
		5 m		XS2F-D421-G80-A
	L-shaped	2 m	-	XS2F-D422-D80-A
	g	5 m		XS2F-D422-G80-A
Detergent resistant cable with	Straight	2 m		Y92E-S12PVC4S2M-L
SUS nuts	Chargent Chargent	5 m		Y92E-S12PVC4S5M-L
	L-shaped	2 m		Y92E-S12PVC4A2M-L
		5 m		Y92E-S12PVC4A5M-L

# Specifications

# Ratings

Item		E3F2-7	E3F2-R4□-□	E3F2-DS10	E3F2-DS30	E3F2-LS10□4-□
Sensing m	ethod	Through-beam	Retro-reflective	Diffuse-reflective		
				Wide beam (fixed)	Potentiometer adjustment	Background suppression
Power sup	ply voltage	10 to 30 V DC				
Current co	nsumption	50 mA max.	30 mA max.	25 mA max.	30 mA max.	
Sensing di	stance	7 m	0.1 to 4 m (with E39-R1S)	0.1 m (5 x 5 cm white mat paper)	0.3 m (10 x 10 cm white mat paper)	0.1 m (10 x 10 cm white mat paper)
Standard o	object	Opaque: 11 mm dia. min.	Opaque: 56 mm dia. min.	-		
Directional	l angle	3° to 20°	3° to 20°	-		
Differential (hysteresis		-		20% max.		5% max
Black/white	e error	-				3% max
Response	time	Operation and Re- set: 2.5 ms max.	1 ms max	2.5 ms max.		1 ms max.
Control ou	tput	Transistor (open col	lector), load current:	100 mA max. (residua	al voltage: 2 V max.)	
Power reset time 50 ms 100 ms max. 50 ms				100 ms		
Ambient illumination Incandescent lamp:3000 lx max. / Sunlight:10000 lx max.						
Ambient te	emperature	Operating: -25 to 55 °C / Storage: -30 to 70 °C (with no icing or condensation)				
Ambient h	umidity	Operating: 35% to 85% / Storage: 35% to 95% (with no condensation)				
Insulation	resistance		/ DC between energized to be tween energized	-		
Dielectric s	strength		/ 60 Hz for 1 min bet	• •		
Vibration r	esistance		double amplitude for		(X, Y, Z)	
Shock resi			s <sup>2</sup> each direction (X, Y			
-	protection <sup>*1</sup>		9K after DIN 40050-			
Light source	ce (wave length)	Infrared LED (950 nm)		Infrared LED (880 n	-	Red LED (660 nm)
Indicators		Light incident / power in- dicator for light source (red)	Light incident (red) / stability (green)	Light incident / powe source (red)	er indicator for light	Output indicator (orange) / stability (green)
Sensitivity adjustment Fixed		Fixed	Adjustable	Fixed	Adjustable	Fixed
Connection	n method	2 m, 5 m pre-wired o	able (PVC, dia. 4 mn	n (18 / 0.12)) or M12-	connector	
Operation	mode	Light-ON or Dark-Of	N selectable by wiring	]		
Weight	Pre-wired (2 m)	180 g	90 g			
(approx.)	Connector	120 g	50 g			
(app: c/a)				oroo polority		
Circuit pro	tection	Output short-circuit a	and power supply rev	erse polarity		
	tection Lens	Output short-circuit a PMMA Stainless steel <sup>*2</sup>	and power supply rev	erse polanty		


\*1. The IP69k test according to DIN 40 050 part 9 is intended to simulate high pressure/steam cleaning. During the test 14-16l/min water at 80°C is sprayed onto the sensor from different angles with 8000-10000kPa. The sensor may not suffer any damaging effects from high pressure water in appearance and functionality. Material-specification for stainless steel housing case: 1.4305 (W.-No.), 303 (AISI), 2346 (SS). For other stainless steel materials please contact your OMRON

\*2. sales representative.


# Engineering Data (Typical)

# Operating Range (typical)


# Through-beam Models

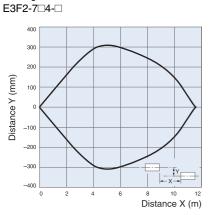


Retro-reflective Models E3F2-R4\_4--

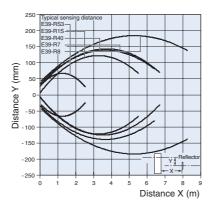

Diffuse-reflective Models E3F2-DS10⊡4-□ (wide-beam type)

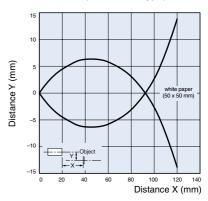



Diffuse-reflective Models E3F2-DS30□4-□

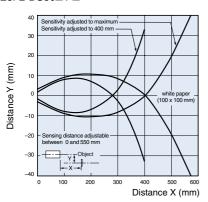


# Excess Gain Ratio vs. Distance (typical)

Through-beam Models E3F2-7□4-□

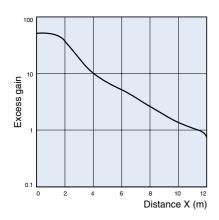

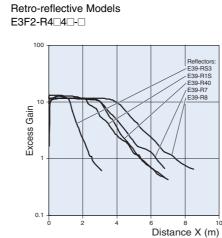


Diffuse-reflective Models E3F2-DS10□4-□ (wide beam type)

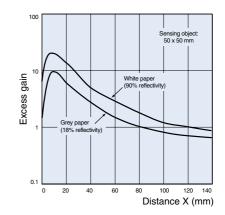

# OMBO

#### **Diffuse-reflective Models** E3F2-DS3004-0

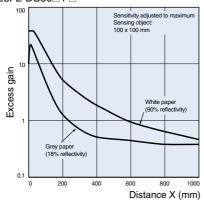




6


Spot diameter(mm)

2


0

# Incline (left and right)



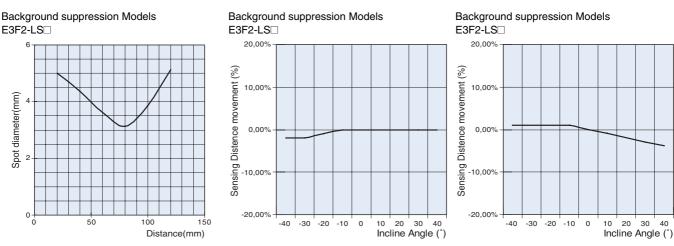

Object material vs sensing distance

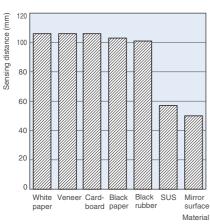


Background suppression Models E3F2-LS

# Operation

# Output Circuits Structure of Sensor I/O Connector

Classification	Wire color	Connector pin No.	Use
	Brown	1	Power supply (+V)
DC	White	2	Mode selec- tion Lon/Don
	Blue	3	Power supply (0 V)
	Black	4	Output



## **PNP** Output

Model	Output transistor status	Timing chart	Connection method	Output circuit
	_	_	_	Through-beam emitter
E3F2-□B4-□ (except for E3F2-LS10B4-□)	ON when light is incident. (Light-ON)	Incident Interrupted Output ON Indicator OFF Output ON Utput ON transistor OFF	Connect the pink (Pin 2) and brown (Pin 1) cords or open the pink cord (Pin 2).	Light indicator 10 to 30 VDC   Red Green   Green Use   Use Use
	ON when light is interrupted. (Dark-ON)	Incident Interrupted Output indicator (red) Output transistor OFF Load (relay) Release	Connect the pink (Pin <sup>②</sup> ) and blue (Pin <sup>③</sup> ) cords.	Light Indicator Stability indicator Brown 10 to 30 VDC   Red Green Black Black   Unit or and the selection Black Black   Pink Mode selection   Connector Pin Arrangement   * Only on models E3F2-F4B4⊟ and E3F2-D1B4-□ Image: Constant of the selection

Model	Output transistor status	Timing chart	Connection method	Output circuit
E3F2-LS10B4-□	ON when light is incident. (Light-ON)	Incident Interrupted Output ON indicator OFF Output ON transistor OFF Load Operate (relay) Release	Connect the pink (Pin 2) and brown (Pin 1) cords or open the pink cord (Pin 2).	Output Indicator Orange Green Green Greut Corcuit Connector Pin Arrangement O O O O O O O O O O O O O O O O O O O
E3F2-LS 10B4-∟	ON when light is interrupted. (Dark-ON)	Incident Interrupted Output indicator (orange) Output transistor Load (relay) Release	Connect the pink (Pin ②) and blue (Pin ③) cords.	Output indicator Orange Green Gre


Note: Terminal numbers for connector type.

# NPN Output


Model	Output transistor status	Timing chart	Connection method	Output circuit
	_		_	Through-beam emitter
E3F2-□C4-□ (except for E3F2-LS10C4-□)	ON when light is incident. (Light-ON)	Incident Interrupted Output (red) OFF Output ON transistor OFF Load Operate (relay) Release	Connect the pink (Pin 2) and brown (Pin 1) cords or open the pink cord (Pin 2).	Output indicator Red Green Wain crcuit Z <sub>2</sub> : V <sub>2</sub> = 36 V Pink Mode selection Connector Pin Arrangement * Only on models E3F2-R4C4-L and E3F2-D1C4-L
	ON when light is interrupted. (Dark- ON)	Incident Interrupted Output (red) OFF Output ON transistor OFF Load Operate (relay) Release	Connect the pink (Pin <sup>©</sup> ) and blue (Pin <sup>©</sup> ) cords.	Output indicator Red Green Green Green Main crcuit Z <sub>2</sub> : V <sub>2</sub> = 36 V Pink Mode selection Connector Pin Arrangement * Only on models E3F2-R4C4-1 and E3F2-D1C4-1 Black © ③ ③ ③ ③ ③ ③
	ON when light is incident. (Light-ON)	Incident Interrupted Output (red) OFF Output ON transistor OFF Load Operate (relay) Release	Connect the pink (Pin 2) and brown (Pin 1) cords or open the pink cord (Pin 2).	Cutput indicator Orrange Green Main circuit Z <sub>C</sub> : V <sub>Z</sub> = 36 V Pink Mode selection Connector Pin Arrangement
E3F2-LS10C4-□	ON when light is interrupted. (Dark- ON)	Incident Interrupted Output indicator (orange) Output transistor (orange) Output transistor OFF Load (relay) Release	Connect the pink (Pin ②) and blue (Pin ③) cords.	Output indicator Orange Green Main Join Cannector Pin Arrangement Connector Pin Arrangement Consector Pin Arrangement


Note: Terminal numbers for connector type.


Dimensions Note: All units are in millimeters unless otherwise indicated

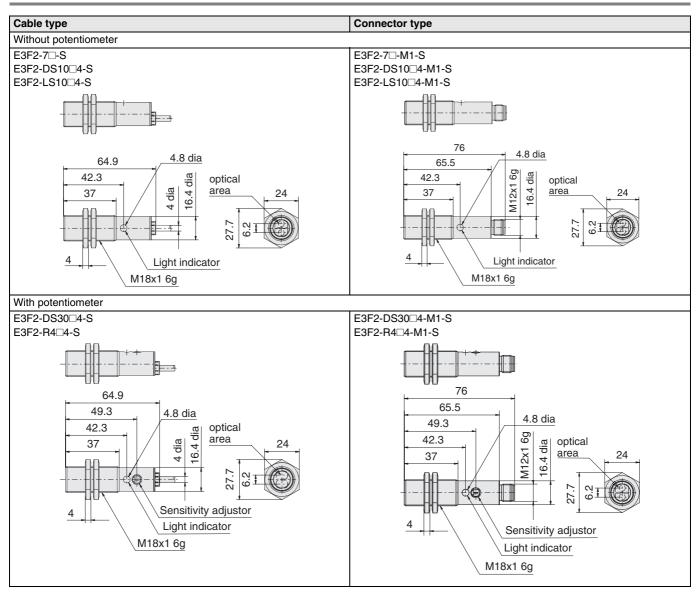


Accessories (Order Separately)

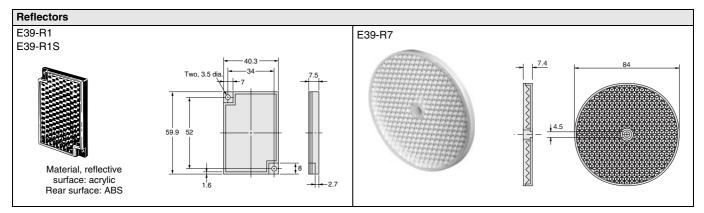

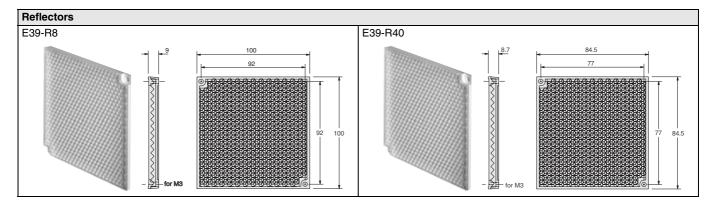

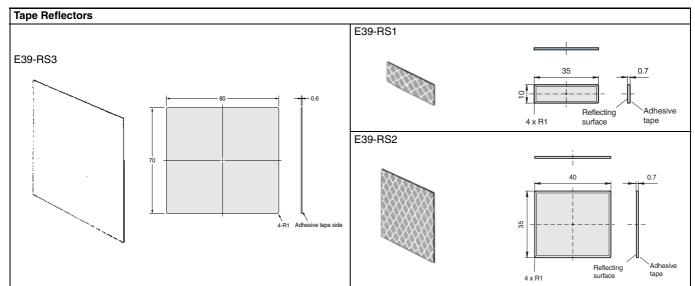

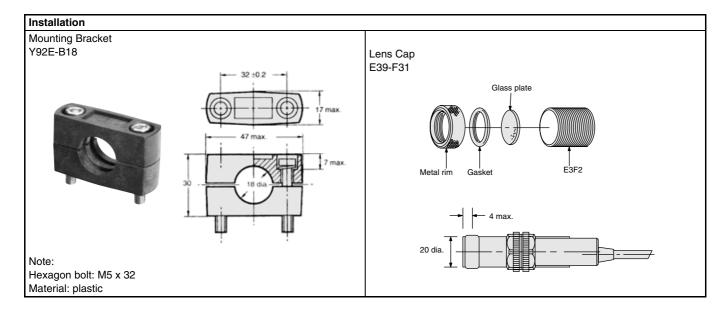

# Safety precautions

# \land Warning

This product is not designed or rated for directly or indirectly ensuring safety of persons. Do not use it for such a purpose.

## / ∩ Caution

Do not use the product with voltage in excess of the rated voltage. Excess voltage may result in malfunction or fire.



Never use the product with an AC power supply. Otherwise, explostion may result.



When cleaning the product, do not apply a high-pressure spray of water to one part of the product. Otherwise, parts may become damaged and the degree of protection may be degraded.

High-temperature environments may result in burn injury.



# Precautions for Safe Use

The following precautions must be observed to ensure safe operation of the Sensor.

## **Operating Environment**

Do not use the Sensor in an environment where explosive or flammable gas is present.

## **Connecting Connectors**

Be sure to hold the connector cover when inserting or removing the connector. Be sure to tighten the connector lock by hand; do not use pliers or other tools. If the tightening is insufficient, the degree of protection will not be maintained and the Sensor may become loose due to vibration. The appropriate tightening torque is 0.39 to 0.49 N·m for M12 connectors.

#### Load

Do not use a load that exceeds the rated load.

Rotation Torque for Sensitivity Adjustment

Adjust with a torque of 0.05 N·m or less.

## Modifications

Do not attempt to disassemble, repair, or modify the Sensor. Outdoor Use

Do not use the Sensor in locations subject to direct sunlight. Cleaning

Do not use thinner, alcohol, or other organic solvents. Otherwise, the optical properties and degree of protection may be degraded. Surface Temperature

Burn injury may occur. The Sensor surface temperature rises depending on application conditions, such as the surrounding temperature and the power supply voltage. Use caution when operating or washing the Sensor.

## Precautions for Correct Use

Do not use the Sensor in any atmosphere or environment that exceeds the ratings.

# Do not install the Sensor in the following locations.

(1) Locations subject to direct sunlight

- (2) Locations subject to condensation due to high humidity
- (3) Locations subject to corrosive gas
- (4) Locations where the Sensor may receive direct vibration or shock

### **Connecting and Mounting**

- (1) The maximum power supply voltage is 30 VDC. Before turning the power ON, make sure that the power supply voltage does not exceed the maximum voltage.
- (2) Laying Sensor wiring in the same conduit or duct as high-voltage wires or power lines may result in malfunction or damage due to induction. As a general rule, wire the Sensor in a separate conduit or use shielded cable.
- (3) Use an extension cable with a minimum thickness of 0.3 mm<sup>2</sup> and less than 100 m long.
- (4) Do not pull on the cable with excessive force.
- (5) Pounding the Photoelectric Sensor with a hammer or other tool during mounting will impair water resistance.
- (6)Mount the Sensor using a bracket (sold separately).
- Do not exceed a torque of 20.0 Nm when tightening mounting nuts.
- (7) Be sure to turn OFF the power supply before inserting or removing the connector.

#### Cleaning

Never use thinner or other solvents. Otherwise, the Sensor surface may be dissolved.

#### Power Supply

If a commercial switching regulator is used, ground the FG (frame ground) terminal.

#### **Power Supply Reset Time**

The Sensor will be able to detect objects 100 ms after the power supply is tuned ON. Start using the Sensor 100 ms or more after turning ON the power supply. If the load and the Sensor are connected to separate power supplies, be sure to turn ON the Sensor first.

## Turning OFF the Power Supply

Output pulses may be generated even when the power supply is OFF. Therefore, it is recommended to first turn OFF the power supply for the load or the load line.

## Load Short-circuit Protection

This Sensor is equipped with load short-circuit protection, but be sure to not short circuit the load. Be sure to not use an output current flow that exceeds the rated current. If a load short circuit occurs, the output will turn OFF, so check the wiring before turning ON the power supply again. The short-circuit protection circuit will be reset.

#### Water Resistance

Do not use the Sensor in water, rainfall, or outdoors.

#### WARRANTY

OMRON's exclusive warranty is that the products are free from defects in materials and workmanship for a period of one year (or other period if specified) from date of sale by OMRON.

OMRON MAKES NO WARRANTY OR REPRESENTATION, EX-PRESS OR IMPLIED, REGARDING NON-INFRINGEMENT, MER-CHANTABILITY, OR FITNESS FOR PARTICULAR PURPOSE OF THE PRODUCTS. ANY BUYER OR USER ACKNOWLEDGES THAT THE BUYER OR USER ALONE HAS DETERMINED THAT THE PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE. OMRON DISCLAIMS ALL OTHER WAR-RANTIES, EXPRESS OR IMPLIED.

### LIMITATIONS OF LIABILITY

OMRON SHALL NOT BE RESPONSIBLE FOR SPECIAL, INDI-RECT, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED ON CONTRACT, WARRANTY, NEGLIGENCE, OR STRICT LIABILITY.

In no event shall responsibility of OMRON for any act exceed the individual price of the product on which liability is asserted.

IN NO EVENT SHALL OMRON BE RESPONSIBLE FOR WARRAN-TY, REPAIR, OR OTHER CLAIMS REGARDING THE PRODUCTS UNLESS OMRON'S ANALYSIS CONFIRMS THAT THE PROD-UCTS WERE PROPERLY HANDLED, STORED, INSTALLED, AND MAINTAINED AND NOT SUBJECT TO CONTAMINATION, ABUSE, MISUSE, OR INAPPROPRIATE MODIFICATION OR REPAIR.

#### SUITABILITY FOR USE

THE PRODUCTS CONTAINED IN THIS DOCUMENT ARE NOT SAFETY RATED. THEY ARE NOT DESIGNED OR RATED FOR EN-SURING SAFETY OF PERSONS, AND SHOULD NOT BE RELIED UPON AS A SAFETY COMPONENT OR PROTECTIVE DEVICE FOR SUCH PURPOSES. Please refer to separate catalogs for OM-RON's safety rated products.

OMRON shall not be responsible for conformity with any standards, codes, or regulations that apply to the combination of products in the

customer's application or use of the product.

At the customer's request, OMRON will provide applicable third party certification documents identifying ratings and limitations of use that apply to the products. This information by itself is not sufficient for a complete determination of the suitability of the products in combination with the end product, machine, system, or other application or use.

The following are some examples of applications for which particular attention must be given. This is not intended to be an exhaustive list of all possible uses of the products, nor is it intended to imply that the uses listed may be suitable for the products:

- Outdoor use, uses involving potential chemical contamination or electrical interference, or conditions or uses not described in this document.
- Nuclear energy control systems, combustion systems, railroad systems, aviation systems, medical equipment, amusement machines, vehicles, safety equipment, and installations subject to separate industry or government regulations.
- Systems, machines, and equipment that could present a risk to life or property.

Please know and observe all prohibitions of use applicable to the products.

NEVER USE THE PRODUCTS FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

#### PERFORMANCE DATA

Performance data given in this document is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of OMRON's test conditions, and the users must correlate it to actual application requirements. Actual performance is subject to the OMRON Warranty and Limitations of Liability.

#### CHANGE IN SPECIFICATIONS

Product specifications and accessories may be changed at any time based on improvements and other reasons.

It is our practice to change model numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the product may be changed without any notice. When in doubt, special model numbers may be assigned to fix or establish key specifications for your application on your request. Please consult with your OMRON representative at any time to confirm actual specifications of purchased products.

#### DIMENSIONS AND WEIGHTS

Dimensions and weights are nominal and are not to be used for manufacturing purposes, even when tolerances are shown.

#### ERRORS AND OMISSIONS

The information in this document has been carefully checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical, or proofreading errors, or omissions.

## PROGRAMMABLE PRODUCTS

OMRON shall not be responsible for the user's programming of a programmable product, or any consequence thereof.

Cat. No. E59E-EN-01

In the interest of product improvement, specifications are subject to change without notice.

# **OMRON EUROPE B.V.**

Wegalaan 67-69, NL-2132 JD, Hoofddorp, The Netherlands Phone: +31 23 568 13 00 Fax: +31 23 568 13 88 www.industrial.omron.eu